
TOP SECRET



OUT62986

1967 AUG 30 23 20 Z

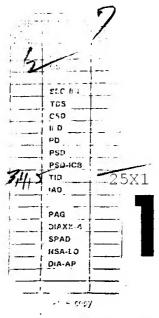

25X1

25X1

AFSSO PACAF AFSSO ACIC AFSSO FTD AFSSO USAFE CNO OPCEN YSAKAKC ZEM

P 302259Z

FM NPIC

TOPSECRETITITT REFERENCE: MISSION 1043 CITE NPIC 1643.

- 1. AN ANOMALY OCCURRED IN THE SCAN RATE OF THE FORWARD CAMERA (NO. 200) FIRST NOTICED IN PASS 68 AND INCREASING TO 40 PERCENT IN THE MIDDLE OF 1043-2. THE SCAN RATE VARIED OVER THE FRAME WIH THE GREATER ERROR AT THE SUPPLY END.
 2. BECAUSE OF THE ERRONEOUS SCAN RATE, IMAGE SMEAR IS
- EVIDENT.
- 3. MENSURATION SHOULD BE MADE FROM THE AFT CAMERA AS THE VARYING SCAN RATE OF THE FORWARD CAMERA WILL SERIOUSLY AFFECT MEASUREMENTS MADE THEREFROM.
- 4. ON PASS 120 THE SCAN RATE WAS INCORRECT FOR BOTH THE AFT AND FORWARD CAMERAS, THEREFOR MEASUREMENT ACCURACY WILL BE AFFECTED.

GP - 1 TOPSECRET

END OF MESSAGE

Declassification Review by NGA

GROUP 1 Excluded from automatic declassification downgrading and

10P SEEREI